

Laboratory Acoustical Test Report

FC23-0780R1

Impact Insulation Class and Sound Transmission Class

ASTM E492, E90

August 25, 2023

Test Assembly:

Shaw Bethany Place Carpet

Shaw Carpet Pad

Gypsum Concrete

Oriented Strand Board Sheathing

MiTek PS10 Truss

Unfaced R-11 Fiberglass Insulation

Resilient Channel

Gypsum Panel

IIC-72

HIIC-83

LIIC-56


STC-51

MiTek

16023 Swingley Ridge Road


Chesterfield, MO 63017

Impact Insulation Class Test FC23-0780: IIC 72

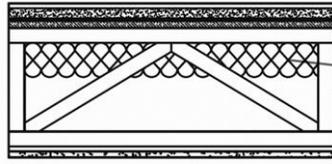

Carpet	19.1 mm Shaw Bethany Place
Carpet Pad	9.5 mm Shaw
Subfloor	Gypsum Concrete
Subfloor Panel	18.3 mm Oriented Strand Board Sheathing
Truss	235 mm MiTek PS10 Truss
Insulation	88.9 mm Johns Manville Unfaced R-11 Fiberglass Insulation
Resilient Channel	12.7 mm ClarkDietrich RC Deluxe™ Resilient Channel
Gypsum Panel	15.9 mm National Gypsum Type C Gypsum Panel


Test Date: February 25, 2023
 Construction Date: February 25, 2023
 Test Specimen Area: 11 sq.m.
 Receiving Room Volume: 156 cu.m.
 Receiving Room Temperature: 17.5-17.6 degrees C
 Receiving Room Relative Humidity: 55-55 percent

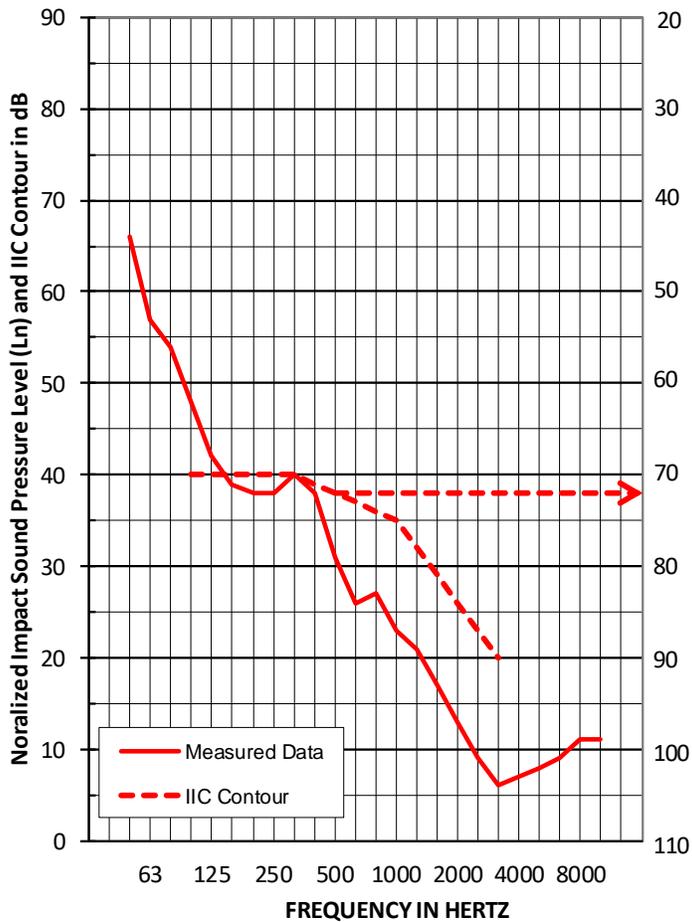

Freq	95% Confidence	
	Limit	Ln
50	1.6	66
63	2.3	57
80	2.5	54
100	1.0	48
125	1.2	42
160	1.1	39
200	1.1	38
250	0.7	38
315	0.4	40
400	0.5	38
500	0.4	31
630	0.4	26
800	0.3	27
1000	0.4	<u>23</u>
1250	0.2	<u>21</u>
1600	0.3	<u>17</u>
2000	0.5	<u>13</u>
2500	0.4	<u>9</u>
3150	0.4	<u>6</u>
4000	0.4	<u>7</u>
5000	0.4	<u>8</u>
6300	0.4	<u>9</u>
8000	0.5	<u>11</u>
10000	0.5	<u>11</u>


Background Affected

High-frequency Impact Insulation Class Test FC23-0780: HIIC 83

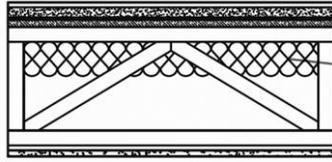

Carpet	19.1 mm Shaw Bethany Place
Carpet Pad	9.5 mm Shaw
Subfloor	Gypsum Concrete
Subfloor Panel	18.3 mm Oriented Strand Board Sheathing
Truss	235 mm MiTek PS10 Truss
Insulation	88.9 mm Johns Manville Unfaced R-11 Fiberglass Insulation
Resilient Channel	12.7 mm ClarkDietrich RC Deluxe™ Resilient Channel
Gypsum Panel	15.9 mm National Gypsum Type C Gypsum Panel


Test Date: February 25, 2023
 Construction Date: February 25, 2023
 Test Specimen Area: 11 sq.m.
 Receiving Room Volume: 156 cu.m.
 Receiving Room Temperature: 17.5-17.6 degrees C
 Receiving Room Relative Humidity: 55-55 percent

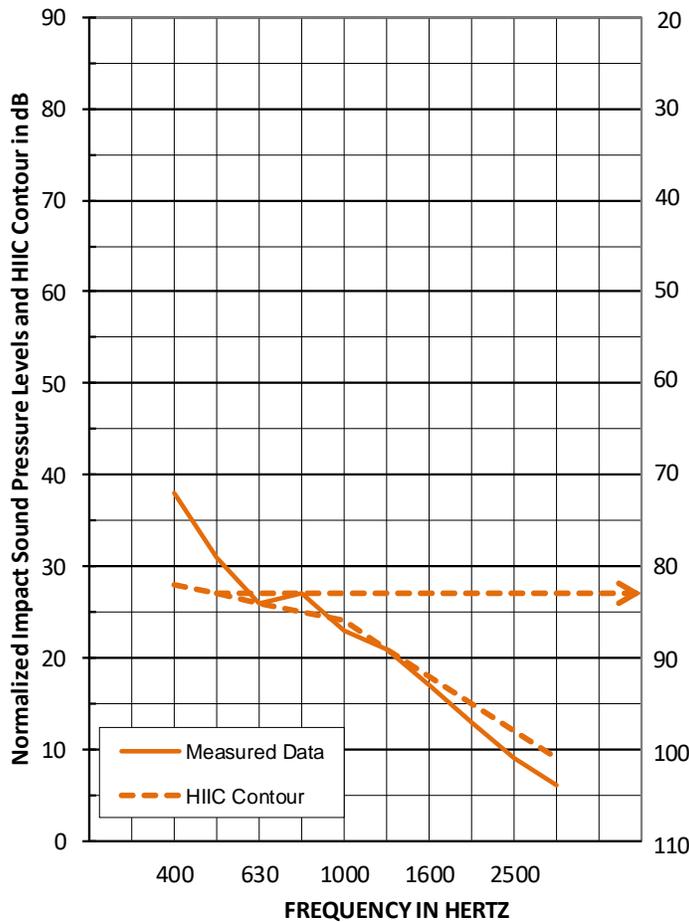

95% Confidence		
Freq	Limit	Ln
400	0.5	38
500	0.4	31
630	0.4	26
800	0.3	27
1000	0.4	<u>23</u>
1250	0.2	<u>21</u>
1600	0.3	<u>17</u>
2000	0.5	<u>13</u>
2500	0.4	<u>9</u>
3150	0.4	<u>6</u>


Background Affected

Sound Transmission Class Test FC23-0780: STC 51

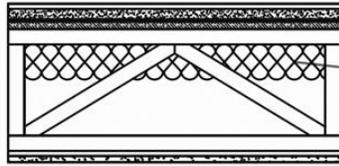

Carpet	19.1 mm Shaw Bethany Place
Carpet Pad	9.5 mm Shaw
Subfloor	Gypsum Concrete
Subfloor Panel	18.3 mm Oriented Strand Board Sheathing
Truss	235 mm MiTek PS10 Truss
Insulation	88.9 mm Johns Manville Unfaced R-11 Fiberglass Insulation
Resilient Channel	12.7 mm ClarkDietrich RC Deluxe™ Resilient Channel
Gypsum Panel	15.9 mm National Gypsum Type C Gypsum Panel

Test Date: February 25, 2023
 Construction Date: February 25, 2023
 Test Specimen Area: 11 sq.m.
 Source/Receiving Room Volume: 190/156 cu.m.
 Source/Receiving Room Temperature: 16.9/17.5 degrees C
 Source/Receiving Room Relative Humidity: 55/55 percent

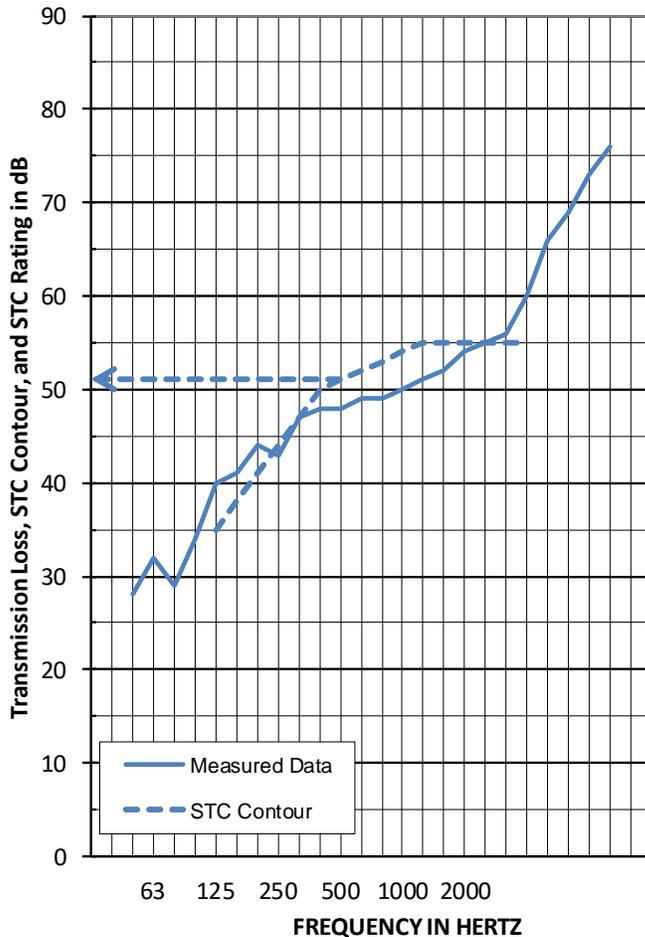

Freq	TL
50	28
63	32
80	29
100	34
125	40
160	41
200	44
250	43
315	47
400	48
500	48
630	49
800	49
1000	50
1250	51
1600	52
2000	54
2500	55
3150	56
4000	60
5000	66
6300	69
8000	<u>73</u>
10000	<u>76</u>

Background Affected

Flanking Affected

Background and Flanking Affected

1.0 TEST PROCEDURES

1.1 Impact Insulation Tests

All tests were conducted in accordance with ASTM E492, "Standard Test Method for Laboratory Measurement of Impact Sound Transmission through Floor-Ceiling Assemblies Using the Tapping Machine." The IIC is a single-number rating derived from the Impact Sound Pressure Level in accordance with ASTM E989, "Standard Classification for Determination of Impact Insulation Class (IIC)." Results are presented above.

95% confidence intervals represent uncertainty for microphone averaging, not tapping positions.

1.2 High-frequency Impact Insulation Class Tests

The HIIC is the High-frequency Impact Insulation Class and is meant to assess the high-frequency impact noise on a floor-ceiling assembly. The higher the value, the better the floor, meaning less noise from high-frequency impacts in the space below.

All tests were conducted in accordance with the requirements of ASTM E492, "Standard Test Method for Laboratory Measurement of Impact Sound Transmission through Floor-Ceiling Assemblies Using the Tapping Machine," using ASTM E3222 "Standard Classification for Determination of High-frequency Impact Sound Ratings" to calculate the High-frequency Impact Insulation Class (HIIC). Results are presented above.

1.3 Low-frequency Impact Insulation Class Tests

The LIIC is the Low-frequency Impact Insulation Class and is meant to assess the low-frequency impact noise on a floor-ceiling assembly. The higher the value, the better the floor, meaning less noise from low-frequency impacts in the space below.

All tests were conducted in accordance with the requirements of ASTM E492, "Standard Test Method for Laboratory Measurement of Impact Sound Transmission through Floor-Ceiling Assemblies Using the Tapping Machine," using ASTM E3207 "Standard Classification for Determination of Low-frequency Impact Noise Ratings" to calculate the Low-frequency Impact Insulation Class (LIIC).

Measured result is LIIC-56.

1.4 Transmission Loss Tests

All tests were conducted in accordance with ASTM E90, "Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions," using the single-direction method. STC is a single-number rating derived from measured values of Sound Transmission Loss through a test specimen in accordance with ASTM E413, "Classification for Rating Sound Insulation." Results are presented above.

2.0 TEST ASSEMBLY

2.1 Assembly Description

The test assembly consists of:

- Shaw Bethany Place Carpet;
- Shaw Carpet Pad;
- Gypsum Concrete;
- Oriented Strand Board Sheathing;
- MiTek PS10 Truss;
- Johns Manville Unfaced R-11 Fiberglass Insulation;
- ClarkDietrich RC Deluxe™ Resilient Channel;
- National Gypsum Type C Gypsum Panel.

Total mass of the floor-ceiling assembly was 782 kg, having an area density of 71.2 kg/m²).

Product/Element	Thickness	Dimensions	Area ^a	Area Density
Carpet	19.1 mm	3048 mm x 2438.4 mm	10.98 m ²	1.49 kg/m ²
Carpet Pad	9.5 mm	3023 mm x 3632 mm	10.98 m ²	1.12 kg/m ²
Gypsum Concrete	19.1 mm	3023 mm x 3632 mm	10.98 m ²	36.62 kg/m ²
Oriented Strand Board Sheathing	18.3 mm	1219 mm x 2438 mm	10.98 m ²	11.71 kg/m ²
Posi-Strut Truss	235 mm	88.9 mm x 2933.7 mm	7 trusses	10.9 kg/truss
Fiberglass Insulation	88.9 mm	520.7 mm x 3023 mm	10.98 m ²	1.32 kg/m ²
Resilient Channel	12.7 mm	68.6 mm x 2902 mm	23.2 m	0.03 kg/m ²
Gypsum Panel	15.9 mm	1219 mm x 3023 mm	10.98 m ²	11.9 kg/m ²

^a Where applicable, length or quantity provided instead of area.

2.2 Installation

The materials were installed in the following manner:

- Carpet: Loose laid.
- Carpet pad: Loose laid.
- Gypsum concrete: Poured directly onto the subfloor underlayment, cured a minimum of 14 days. The gypsum panel had a closed cell foam perimeter isolation. No noticeable shrinkage or cracking was visible on the specimen.
- Oriented strand board sheathing: Upper layer fastened to trusses with 6D framing nails 305 mm centers perimeter and in the field. Lower layer fastened to trusses with 8D framing nails 305 mm centers perimeter and in the field.
- Trusses: Installed on 610 mm centers using MiTek joist hanger brackets
- Fiberglass insulation: Installed in the cavity between trusses, draped over the resilient channels.
- Resilient channel: Installed on 406 mm centers perpendicular to the trusses.
- Gypsum panel: Fastened to the channels on 203 mm centers with 31.8 mm Type S bugle head screws. The seams of the gypsum panels were sealed with Pecora AC-20 FTR caulk and covered with pressure sensitive tape.

The assembly was constructed on February 25, 2023.

3.0 TESTING PROTOCOL

This report summarizes laboratory acoustical testing contracted by Veneklasen to be completed for MiTek on MiTek's Open Web Truss under Shaw Bethany Place Carpet. The scope of the acoustical testing is for Impact Insulation Class (IIC), Low-frequency Impact Insulation Class (LIIC), High-frequency Impact Insulation Class (HIIC), and Sound Transmission Class (STC), in accordance with ASTM standards E492, E90.

The tests were conducted on February 25, 2023. Details of the tests are contained in this report. Testing was completed in strict accordance with the following standards:

- ASTM E90, "Standard Test Method for Laboratory Measurement of Airborne Sound Transmission Loss of Building Partitions"
- ASTM E413, "Classification for Rating Sound Insulation"
- ASTM E492, "Standard Test Method for Laboratory Measurement of Impact Sound Transmission through Floor-Ceiling Assemblies Using the Tapping Machine"
- ASTM E989, "Standard Classification for Determination of Impact Insulation Class (IIC)"
- ASTM E2235, "Standard Test Method for Determination of Decay Rates for Use in Sound Insulation Test Methods"
- ASTM E3207, "Standard Classification for Determination of Low-frequency Impact Noise Ratings."
- ASTM E3222, "Standard Classification for Determination of High-frequency Impact Sound Ratings."

3.1 Equipment

Equipment list and information associated with this test, including calibration information, is included in the Appendix.

3.2 Accreditation and Reporting

Report must be distributed in its entirety except with written authorization from Veneklasen Associates. Test was conducted at IAS-accredited test facility; the full report is available upon request. Detailed test procedures, data for flanking limit tests, repeatability measurements, and reference specimen tests are available on request.

Veneklasen Associates provides no warranties, expressed or implied, regarding the structural integrity or fitness of these assemblies for a specific installation. Any advertising which utilizes this test report or test data must not imply product certification or endorsement by Veneklasen Associates, NVLAP, NIST or the U.S. Government.

Sincerely,
Veneklasen Associates, Inc.



John LoVerde, FASA
Principal

APPENDIX

Test Equipment and Photos

Instrument	Manufacturer	Model	Description	Serial Number	Calibration Date
2-Channel Analog Input	National Instruments	NI 9250	2-Channel Analog Input	INT02586	04/22
2-Channel Analog Input	National Instruments	NI 9250	2-Channel Analog Input	INT02587	04/22
2-Channel Analog Input	National Instruments	NI 9250	2-Channel Analog Input	INT02608	04/22
2-Channel Analog Input	National Instruments	NI 9250	2-Channel Analog Input	INT02609	04/22
2-Channel Analog Input	National Instruments	NI 9250	2-Channel Analog Input	INT02610	04/22
2-Channel Analog Input	National Instruments	NI 9250	2-Channel Analog Input	INT02612	04/22
2-Channel Analog Input	National Instruments	NI 9260	2-Channel Analog Output	INT02573	04/22
Microphone calibrator	Norsonic	34093	Acoustical calibrator	65105	10/22
Receive room microphone	PCB Piezotronics	378C20	Microphone and preamplifier	63741	06/22
Receive room microphone	PCB Piezotronics	378B20	Microphone and preamplifier	63740	04/22
Receive room microphone	PCB Piezotronics	378B20	Microphone and preamplifier	65969	06/22
Receive room microphone	PCB Piezotronics	378B20	Microphone and preamplifier	63747	01/23
Receive room microphone	PCB Piezotronics	378B20	Microphone and preamplifier	65968	01/23
Receive room environmental indicator	Comet	T7510	Temperature and humidity transmitter	63812	10/22
				63811	10/22
Source room microphone	PCB Piezotronics	378C20	Microphone and preamplifier	65103	02/22
Source room microphone	PCB Piezotronics	378C20	Microphone and preamplifier	65617	08/22
Source room microphone	PCB Piezotronics	378C20	Microphone and preamplifier	63739	04/22
Source room microphone	PCB Piezotronics	378C20	Microphone and preamplifier	63742	04/22
Source room microphone	PCB Electronics	378C20	Microphone and preamplifier	64906	04/22
Source room environmental indicator	Comet	T7510	Temperature and humidity transmitter	63810	10/22
Tapping machine	Norsonic	Nor277	Tapping machine	2776111	04/22
Test Chamber Receive Room Volume			156 m ³		
Test Chamber Source Room Volume			190 m ³		



Photo 1: View of Source Chamber, carpet installation observed



Photo 2: View of Receive Chamber, bottom of gypsum panel observed